



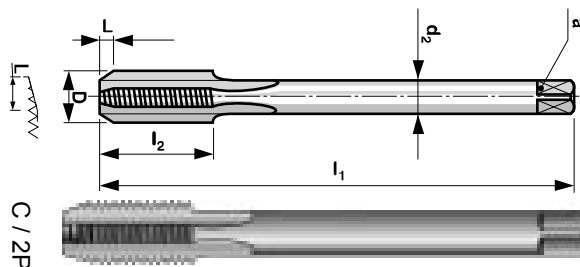

## Метчици машинни, ситна стъпка, DIN 374, HSS

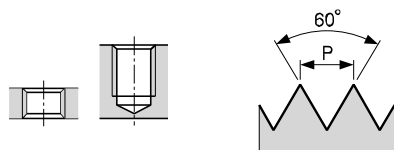

D	P	l <sub>1</sub>	l <sub>2</sub>	d <sub>2</sub>	a	препоръчителен размер на свредлото, мм	D	P	l <sub>1</sub>	l <sub>2</sub>	d <sub>2</sub>	a	препоръчителен размер на свредлото, мм
mm	mm	mm	mm	mm	mm		mm	mm	mm	mm	mm	mm	
<b>D</b>	<b>P</b>	<b>l<sub>1</sub></b>	<b>l<sub>2</sub></b>	<b>d<sub>2</sub></b>	<b>a</b>		<b>M 16</b>	1	100	22	12,0	9,0	15,0
<b>M 3</b>	0,35	56	8	2,2	-	2,65	<b>M 18</b>	1,5	110	25	14,0	11,0	16,5
<b>M 4</b>	0,5	63	10	2,8	2,1	3,5	<b>M 18</b>	1	110	25	14,0	11,0	17,0
<b>M 5</b>	0,5	70	12	3,5	2,7	4,5	<b>M 20</b>	1,5	125	25	16,0	12,0	18,5
<b>M 6</b>	0,75	80	14	4,5	3,4	5,2	<b>M 20</b>	1	125	25	16,0	12,0	19,0
<b>M 6</b>	0,5	80	14	4,5	3,4	5,5	<b>M 22</b>	1,5	125	25	18,0	14,5	20,5
<b>M 8</b>	1	90	22	6,0	4,9	7,0	<b>M 22</b>	1	125	25	18,0	14,5	21,0
<b>M 8</b>	0,75	80	18	6,0	4,9	7,2	<b>M 24</b>	2	140	28	18,0	14,5	22,0
<b>M 10</b>	1,25	100	24	7,0	5,5	8,3	<b>M 24</b>	1,5	140	28	18,0	14,5	22,5
<b>M 10</b>	1	90	20	7,0	5,5	9,0	<b>M 24</b>	1	140	28	18,0	14,5	23,0
<b>M 10</b>	0,75	90	20	7,0	5,5	9,2	<b>M 25</b>	1,5	140	28	18,0	14,5	23,5
<b>M 12</b>	1,5	100	22	9,0	7,0	10,5	<b>M 26</b>	1,5	140	28	18,0	14,5	24,5
<b>M 12</b>	1,25	100	22	9,0	7,0	10,3	<b>M 27</b>	2	140	28	20,0	16,0	25,0
<b>M 12</b>	1	100	22	9,0	7,0	11,0	<b>M 27</b>	1,5	140	28	20,0	16,0	25,5
<b>M 14</b>	1,5	100	22	11,0	9,0	12,5	<b>M 27</b>	1	140	28	20,0	16,0	26,0
<b>M 14</b>	1,25	100	22	11,0	9,0	12,8	<b>M 28</b>	1,5	140	28	20,0	16,0	26,5
<b>M 14</b>	1	100	22	11,0	9,0	13,0	<b>M 30</b>	2	150	28	22,0	18,0	28,0
<b>M 16</b>	1,5	100	22	12,0	9,0	14,5	<b>M 30</b>	1,5	150	28	22,0	18,0	28,5
							<b>M 30</b>	1	150	28	22,0	18,0	29,0